



# TEMP-GARD III SHOWER UNIT


## Z7300-SSC-HW11-MT-VB

### TAG



#### ENGINEERING SPECIFICATIONS: ZURN Z7300-SSC-HW11-MT-VB

Single handle pressure balancing mixing tub and shower unit, ceramic control cartridge with stainless steel balancing piston, built in reverse connection capability (To reverse the hot and cold inlets simply remove cartridge and turn 180°), two service stops / check stops, and adjustable limit stop. When valve is turned on it must rotate from cold through to the hot position. All exposed trim and handle are metal with polished nickel chrome plated surface. Valve supplied with in-line vacuum breaker, hand/wall shower head, hand/wall unit, 60" [1524mm] flexible metal hose, 30" [762mm] mounting bar, supply elbow and flange. The valve inlets and shower outlet are 1/2" female copper sweat connections.

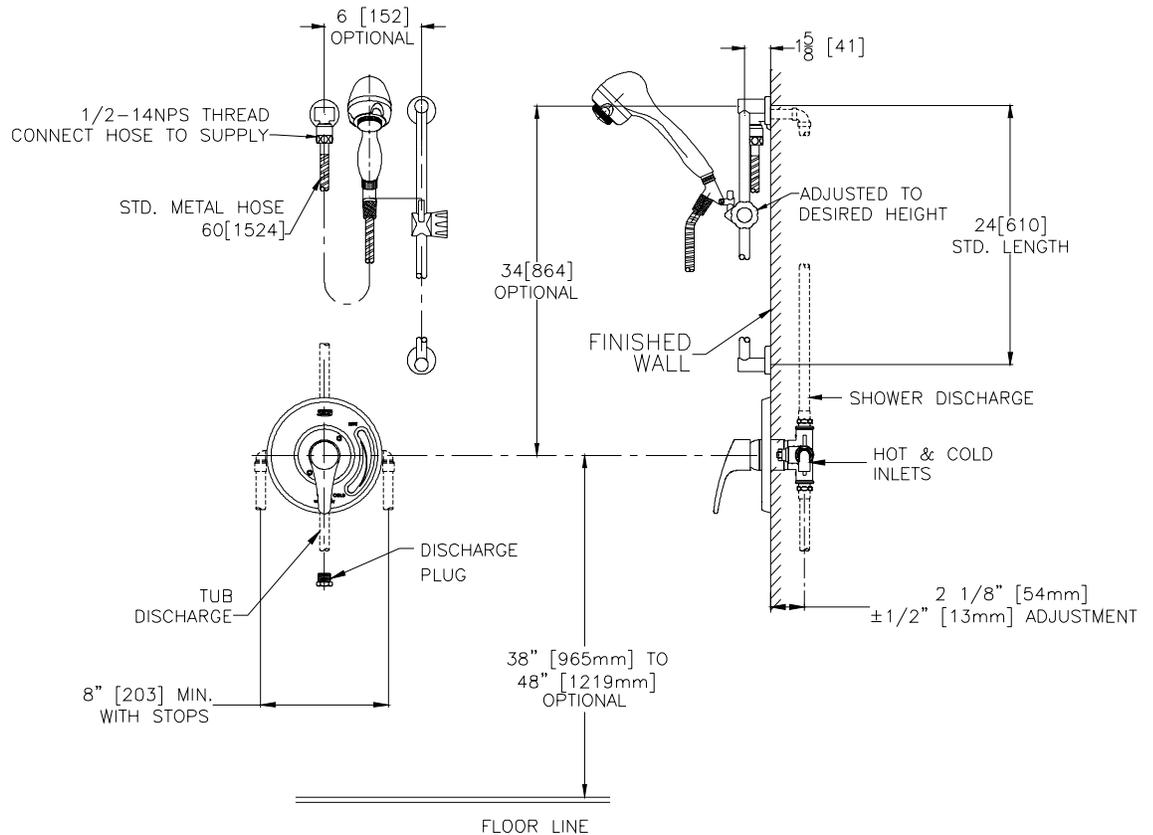

Note: All dimensions are for reference only. Do not use for pre-plumbing.  
Parts shown as hidden lines are supplied by others.

#### OPTIONS (Check/specify appropriate options) Use with Z7300 prefix

Suffix	Description
___ -CPVC	1/2" Male NPT by CPVC Female Adaptors, shipped loose to be installed in the field.
___ -EXT	Extension Kit, Extends Valve Out by 1".
___ -PEX	1/2" Male NPT by PEX Adaptors, shipped loose to be installed in the field
___ -ST	Sierra Series Decorative Metal Trim
___ -WF	Wall Mounting Flange For Fiberglass or Panel Wall Installation
___ -	Handwall Options (see Z7000-HW)

#### STANDARDS

Tested to meet the following standards for valves and plumbing fittings:  
ASSE Standard No. 1016  
ASME A112.18.1 / CSA B125.1  
IAPMO® Listed  
Meets or Exceeds ANSI A117.1M standard for physically handicapped

#### Additional Options

\_\_\_ Z7000-SC Pair of Dual Spring Check Valves



ZURN INDUSTRIES, LLC ♦ COMMERCIAL BRASS OPERATION ♦ 2640 SOUTH WORK STREET ♦ FALCONER NY 14733

Phone: 1-716-665-1132 ♦ Fax: 1-716-665-1135 ♦ World Wide Web: www.zurn.com

In Canada: ZURN INDUSTRIES LIMITED ♦ 3544 Nashua Drive ♦ Mississauga, Ontario L4V1L2 ♦ Phone: 905/405-8272 Fax: 905/405-1292